

Manhole Inspection Summary

Manhole # S05GG1028MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **05GG1** Node: **028** Status: **Found**

Insp Date: **1/29/08 11:32 AM**

Incomplete Comments

Crew: **BC JD**
Inspector: **Daly**
Firm: **URS**

Location Address: **3921 RIDGEWOOD AVE**

Cross Street: **N/A**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Wet**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☐ Sound ☒ **Cracked** ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **3** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


Steps Count: **4** Missing: **1** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View

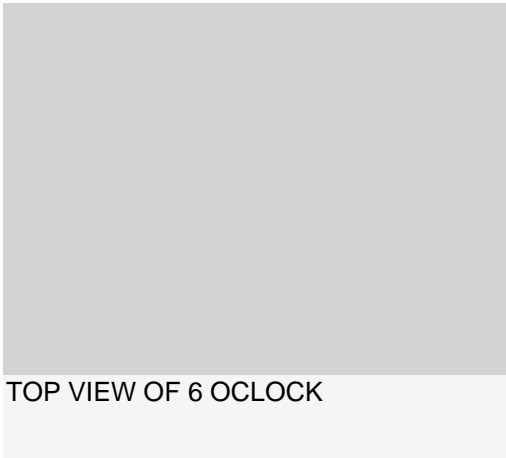


TOP VIEW OF 6 OCLOCK

Top View



Defect 1

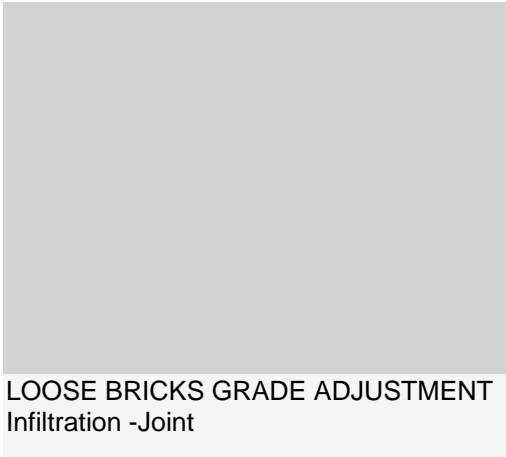

LOOSE BRICKS GRADE ADJUSTMENT
Infiltration -Joint

Manhole Inspection Summary

Manhole # S05GG1028MH

Printed On: 6/24/2010

Page 3 of 3

8 in. Circular Gravity Sewer

12 O'Clock Outflow

Pipe Out @ 12 O'Clock

Pipe Out @ 12 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.50** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**



☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock

Drop In @ 6 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **8.30** (ft.)

Inv Depth: **9.30** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection